6.34 ALARM 960 (SUB-CPU ERROR)

960 : A sub-CPU error (illegal interrupt) occurred.

Cause and corrective action

(1) Sub-CPU printed-circuit board defective

An interrupt that would not occur under a usual condition occurred. It is likely that a CPU peripheral circuit malfunctioned. Replace the sub-CPU printed-circuit board. If a normal operation can be resumed by turning the power off and on again, the

malfunction may have occurred due to noise. <u>See Subsec. 2.3.13 for</u> how to eliminate the effect of noise.