

## 8.36 ALARM 950 (PMC SYSTEM ALARM)

### Causes and Remedies

- For PMC-RB

- For PMC-RC

### Module mounting position (Main CPU)

An error occurred when RAM test is being executed.


The following causes are considered :

Fault on Main CPU board

- PMC control module (3) is faulty.
- DRAM module (2) is faulty.
- FROM module (1) is faulty.
- Main CPU board is faulty.

Fault on Option 3 board

- PMC control module (5) is faulty.
- DRAM module (4) is faulty (Option 3 board)
- Option 3 board is faulty.

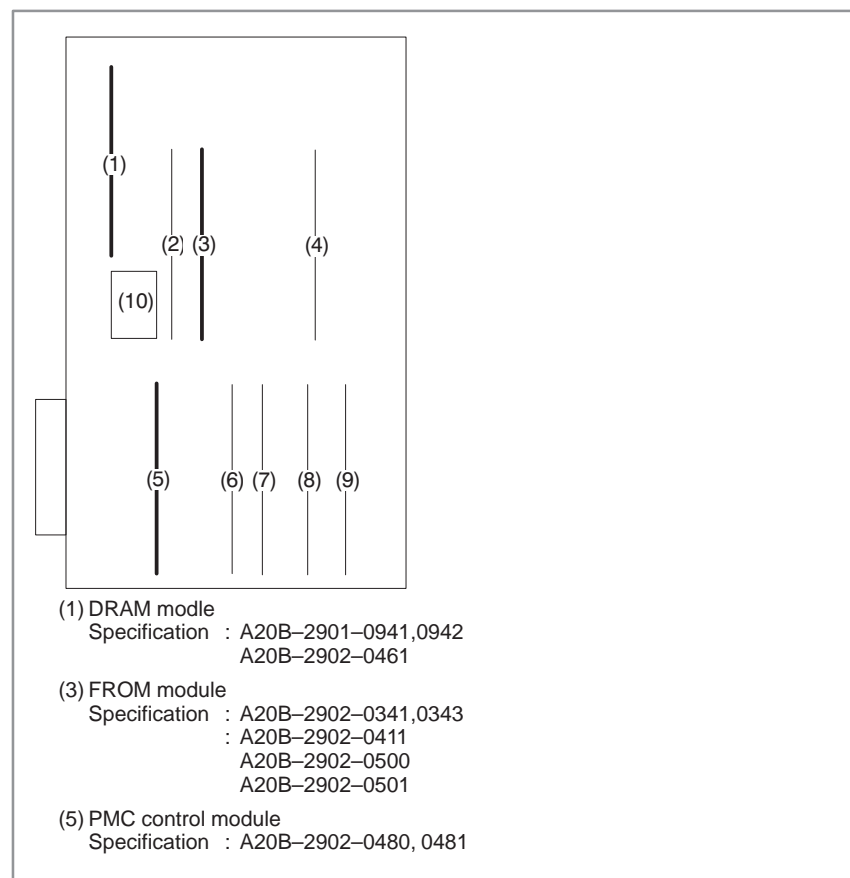

**Module mounting  
position  
(Option 3 board)**